

OPERATION MANUAL

FORCE GAUGE

FG Series



OPERATION MANUAL

FORCE GAUGE

FG Series

File: ER-FA-140-01-10 FA0007 GB

Contents:

1. Introduction	_____
2. Set3	_____
3. Safety instructions	_____
4. Rules for handling a worn force gauge	_____
5. Technical data	_____
6. Keys and indicators	_____
7. Preparing the force gauge for operation	_____
8. General rules for use	_____
9. Turning on the gauge	_____
10. Description of measurement methods	10
10.1 Measuring actual and peak value of a pressure/pull force	10
10.2 Measurement of the mass – using the gauge as scales	11
11. Connecting external devices	14
12. User's Menu	15
13. Applications	15
13.1 Data memory	16
13.2 Comparison with threshold values MIN / OK / MAX	19
14. Units	20
15. Configuration	21
15.1 Speed of measurement	21
15.2 Auto-reset	22
15.3 Print settings	23
15.4 Setting parameters for the RS-232C serial connector	24
15.5 LCD settings	25
15.6 Selecting the menu language	26
15.7 Setting date and time	26
15.7 Setting date and time	27
15.8 Turning the sound ON/OFF when using the keypad (buzzer)	28
15.9 Automatic power OFF (Auto-OFF)	28
15.9 Automatic power OFF (Auto-OFF)	29
15.10 Monitoring the batteries' charge level (Battery)	29
15.10 Monitoring the batteries' charge level (Battery)	30
15.11 Reset settings	31
16. Calibration	31
16. Calibration	32
17. Maintenance, troubleshooting and repairing minor types of damage	33

1. Introduction

The FA series force gauges are designed for measuring pressure or pulling force in laboratory, manufacturing and quality control applications.

The gauge can be held in hand or mounted on a stand (using the four threaded holes at the bottom of the enclosure).


The RS232C serial connector allows the measurement results to be transmitted to a computer or a printer for further analysis or recording.

2. Set

The basic set includes the following elements:

1. Force gauge,
2. Push tips – 4 pcs, 1 hook tip, 1 extension piece
3. Power supply unit ~230 V 50 Hz / =12 V; 1.25 A,
5. SK-1 cord (dynamometer – computer),
6. SK-1 cable,
7. CD containing an operation manual and software,
8. Warranty.

3. Safety instructions

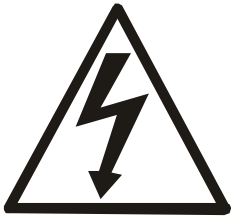

Read carefully the safety instructions included below. Observe these instructions to avoid electrocution or damage to the force gauge itself or other devices connected to the force gauge.

- Repairs and any necessary adjustments may only be conducted by qualified personnel.
- Do not use the force gauge when any part of the enclosure has been removed.
- Do not use the force gauge in potentially explosive atmospheres.
- Do not use the force gauge in areas with a high humidity.
- In the case of suspected damage to the force gauge, turn off the gauge and do not use it until it is examined by a specialised servicing facility.

4. Rules for handling a worn force gauge




According to the applicable regulations on the protection of the environment, do not put worn electronic devices in containers for common waste.

- When put out of operation, a worn force gauge can be delivered to bodies authorised to collect old electronic equipment or to the point of purchase.

5. Technical data

Type	FA50	FA200
Maximum force measured	50 N (5kg)	200 N (20kg)
Reading graduation (d)	0.01 N (1 g)	0.1 N (10 g)
Accuracy	±0.4%	±0.4%
Measurement units	N, g, lb, oz, kg	
Maximum overload	±120%	
Operating temperature	-10 ÷ 40°C	
Interface	RS-232C	
Assistance software	Procell + Excel spreadsheet	
Display	graphic LCD 61 x 34 mm	
Measurement functions		
Power supply	NiMH R3 batteries (AAA size) – 6 pcs + power supply unit ~230 V 50 Hz / 12 V 1.2 A	
Gauge plunger	11 mm (thread M6 x 9 mm)	
Dimensions	210 x 110 x 40 mm	
Weight	700 g	

6. Keys and indicators

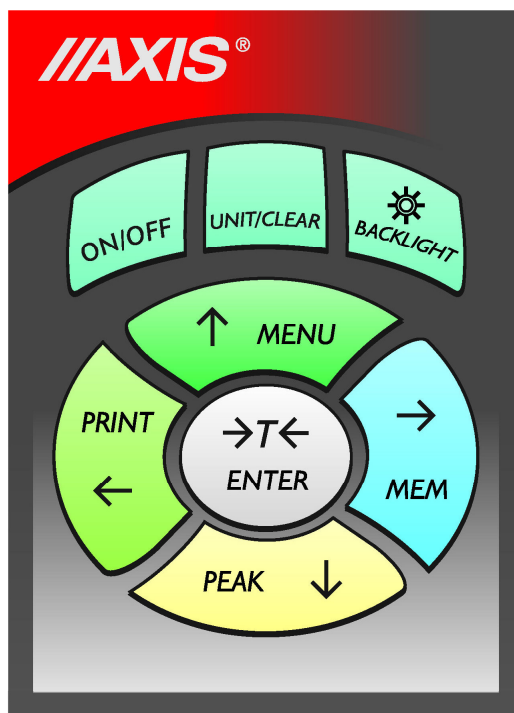

Main keys:

ON/OFF
UNIT/CLEAR
BACKLIGHT
ENTER
→T←
(→0←)

- ON / OFF key (standby),
- Change units / cancel selection or change a parameter value,
- Turn on illumination (ECO mode),
- Confirm / select an option or a digit,
- Taring / resetting (entering the current reference value to be subtracted from the measured values in each consecutive measurement)

Navigation keys:

MENU
↑
↓
→
←

- Confirm the entered parameter or select a highlighted option,
- Move cursor up or increase the digit marked by the cursor,
- Move cursor down or decrease the digit marked by the cursor,
- Move to the next menu level or display the next option,
- Move to the previous menu level or display the previous option.

Function Keys:

PEAK
MEM
PRINT

- Measure the maximum value,
- Save the result to the memory, press and hold – save to memory menu,
- Print result (transmission via RS-232C connector).

Indicators:



 SLW/FST
 ACQ

- Indicates that the weighing result has stabilised,
- Appears after turning off the gauge using the ON/OFF key (standby),
- Slow/fast measurement mode,
- Automatically acquire measurement results.

Note:


Numbers are entered using the navigation keys. First, the cursor is placed in the right digit position.

7. Preparing the force gauge for operation



If the force gauge has been transported from an area with low temperature to an area with a higher temperature, e.g. during winter, water may condensate on the gauge's enclosure. In such a case, do not turn on the gauge's power supply, as it may lead to damage to the gauge or improper operation. Before turning on the gauge, leave it for 1 hour to acclimatise.

1. Take the gauge out of the case.
2. Fit a measurement tip suitable for the measurements to be conducted on the gauge plunger.

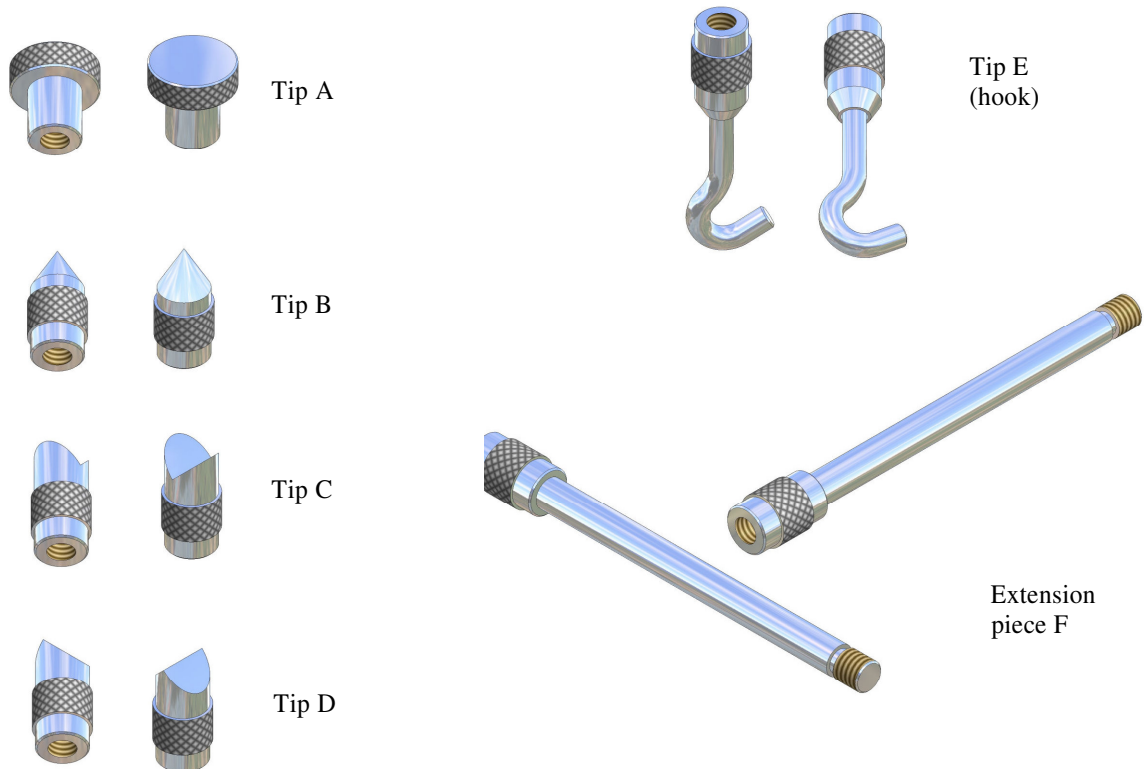

Intended use of the individual tips:

- tip A – measurement of surface pressure force,
- tip B – measurement of point pressure force,
- tip C – measurement of pressure on an axis or an edge,
- tip D – measurement of edge pressure force,
- tip E – hook for measuring pull force or suspending and weighing an object,
- tip F – extension piece suitable for all types of above-mentioned tips.



8. General rules for use



When transporting the force gauge, unscrew the measurement tip and put the gauge in the case to protect it against accidental pressure on the gauge plunger.

1. When conducting measurements by hand, make sure that the direction of the measured force is identical with the gauge's axis (axis of the gauge plunger). Otherwise, only a component force along the gauge's axis will be measured.
2. The gauge allows for resetting in the entire measurement range (this operation is called taring in the case of measuring the mass) by pressing the $\rightarrow T(0) \leftarrow$ key. Resetting/taring does not extend the measurement range but only subtracts the entered reference value from the measured value.
3. The measurement mechanism is a precision device and is sensitive to shocks and vibrations. It is not allowed to hit the measurement tip against any objects.
4. Do not overload the gauge above the maximum overload value (20%).

9. Turning on the gauge

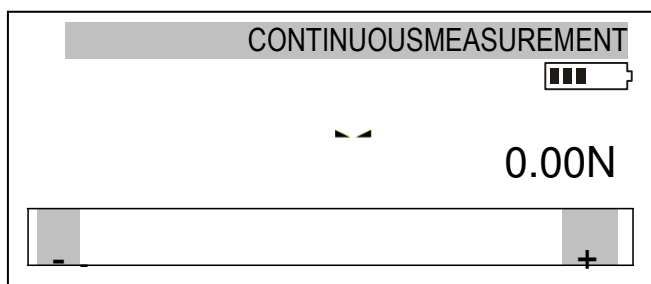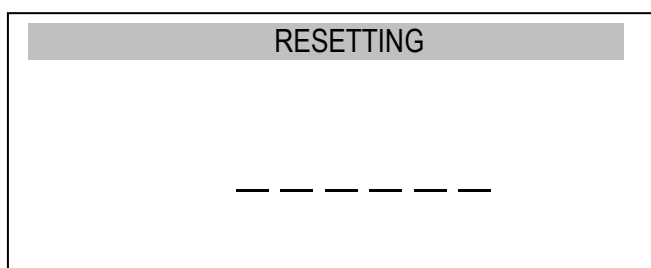

Place the gauge in the operating position, e.g. horizontal position (by laying it on a table). Turn on the gauge by pressing the ON/OFF key.

When necessary, plug the gauge's power supply unit to a ~230 V/50 Hz socket and connect the power supply unit's plug to the gauge's 12 V socket.

The gauge automatically tests the electronic subassemblies and then resets. During this operation, the gauge should remain stationary and its sensor should not be affected by any forces.

After the resetting has been successfully completed, the gauge indicates zero.

Unsuccessful resetting is signalled by an appropriate message.

Note:


It is possible to accelerate the resetting process by pressing the MENU key, which will recall the results from the previous resetting.

If the batteries are low, leave the gauge's external power supply unit ON until they are fully recharged. The batteries' charge level is signalled by an indicator in the upper section of the display.


10. Description of measurement methods

The gauge can be used to measure pressure and pull forces. In addition, when mounted properly, it can be used as suspension scales to measure the mass.




10.1 Measuring actual and peak value of a pressure/pull force

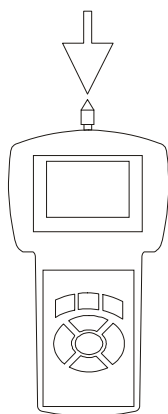

Measuring pressure force

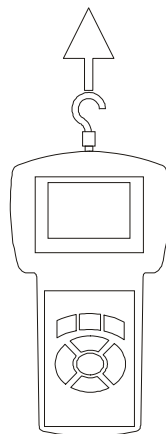

Measuring pull force

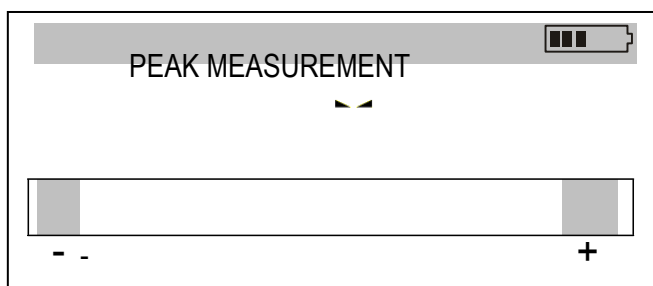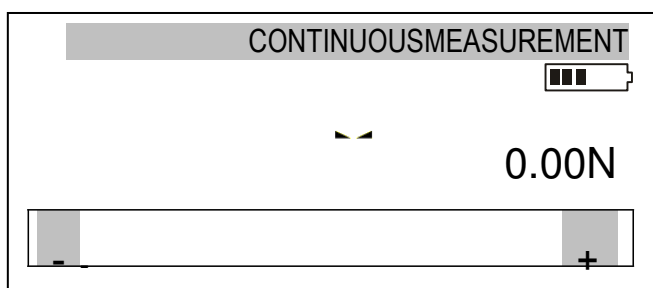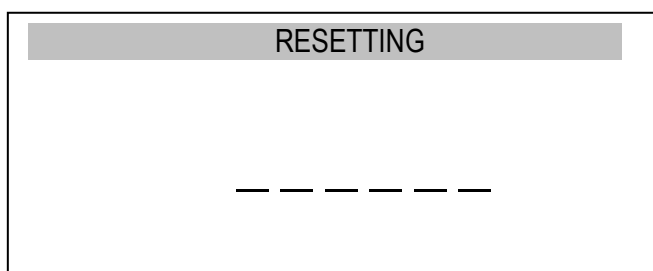

Before starting the measurement, choose a suitable measurement tip, screw it to the gauge plunger and reset the gauge in the operating position, e.g. horizontal position (laying the gauge on a table). The resetting process starts automatically after turning on the gauge or by pressing the $\rightarrow T(0) \leftarrow$ key.

To perform the measurement, indicate the force direction using an arrow in the display's lower bar section and "+" (pressure) or "-" (pull force) symbol.

actual value (continuous measurement) to the maximum value (peak measurement), use the PEAK key.

When measuring a force whose

indicates the value of the force exerted in the direction in which the maximum value was last exceeded.

10.2 Measurement of the mass – using the gauge as scales


When using an additional element (bowl, basket, etc.) for suspending an object to be weighed, the gauge can be used to measure the mass. In the case of measurements which do not require a high level of precision, the gauge can be hand-held. To ensure maximum precision of the measurement, the gauge should be mounted on a stand using the four threaded holes at the bottom of the enclosure or it can be suspended using a special suspension element (option available on request).

Since the value of the gravity force used to calculate the mass depends on the gravitational acceleration in the location where the gauge is used, the device is calibrated for a specific value of the gravitational acceleration. The factory preset value is the gravitational acceleration in Gdańsk ($g_R = 9.81415 \text{ m/s}^2$). In the case of significant differences, see the value applicable for the gauge's shipment address. When transporting the gauge to a location where the gravitational acceleration differs significantly, recalibrate the gauge.


The values of the gravitational acceleration for some of the Polish cities are presented in the table below.

Gravitational acceleration for selected cities



City	$g_R[\text{m/s}^2]$	City	$g_R[\text{m/s}^2]$
AXIS	9.81415	Olsztyn	9.81354
Gdańsk	9.81446	Łódź	9.81164
Gdynia	9.81453	Mława	9.81295
Białystok	9.81294	Opole	9.81076
Bydgoszcz	9.81327	Piła	9.81330
Chojnice	9.81342	Poznań	9.81266
Cieszyn	9.80960	Przemyśl	9.80991
Częstochowa	9.81061	Przeworsk	9.81009
Elbląg	9.81430	Radom	9.81146
Ełk	9.81361	Rybnik	9.81008
Gliwice	9.81025	Rzeszów	9.81010
Gorzów Wielkopolski	9.81305	Słupsk	9.81449
Grudziądz	9.81368	Suwałki	9.81377
Kalisz	9.81184	Szczecin	9.81370
Katowice	9.81008	Tarnów	9.81005
Kielce	9.81063	Toruń	9.81313
Koszalin	9.81427	Warszawa	9.81240
Kraków	9.81005	Włocławek	9.81288
Leszno	9.81206	Wrocław	9.81131
Lublin	9.81128	Zielona Góra	9.81190

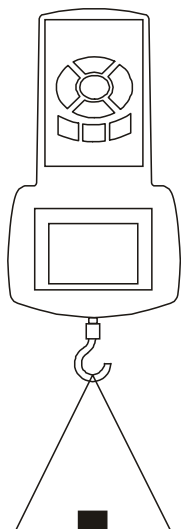


Measurement
using a hand-held gauge

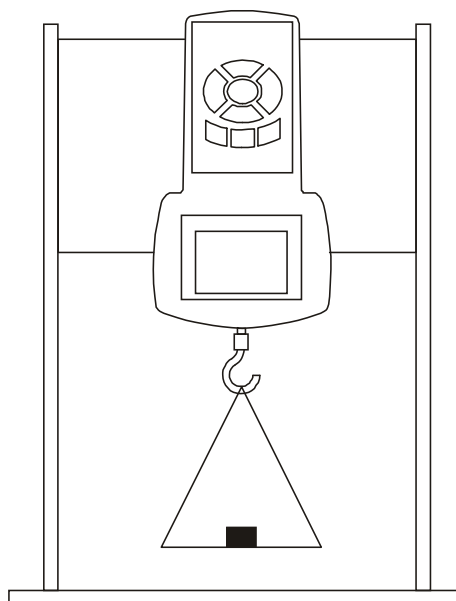


Measurement using a gauge
mounted on a stand
(stand available on request)

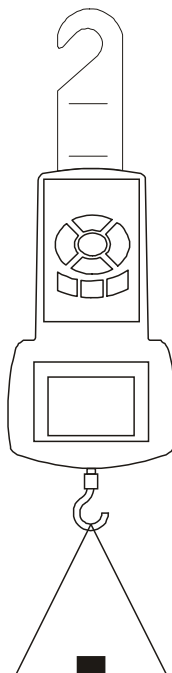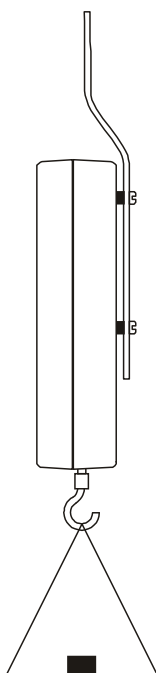

 
Suspended weight measurement
(suspension element available on request)




Screw the hook tip to the gauge plunger, suspend a bowl on the hook and place the gauge in the operating position (as shown in the figure). The display's indications will rotate by 180°.

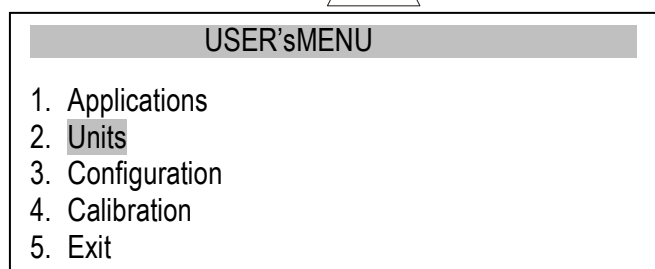


To change force units to mass units, press the UNIT/CLEAR or MENU key several times. When using the MENU key, move the cursor to Units and press ENTER.

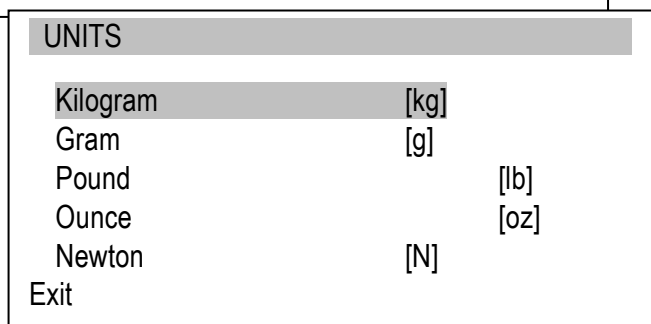


Move the cursor to a mass unit (kilogram or gram) and press ENTER.

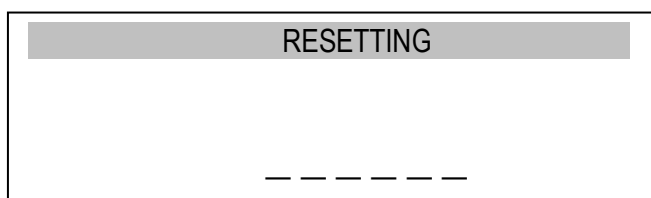

 Reset the gauge in the operating position by pressing the →T(0)← key.




Place the object to be weighed on the bowl.

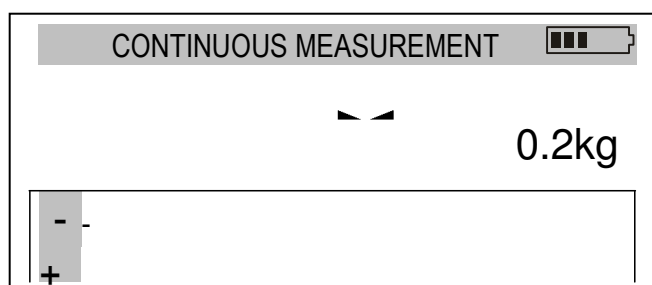

Read the mass.

11. Connecting external devices

The force gauge is equipped with a socket for an external power supply unit and RS232C serial connector for a printer or a computer.

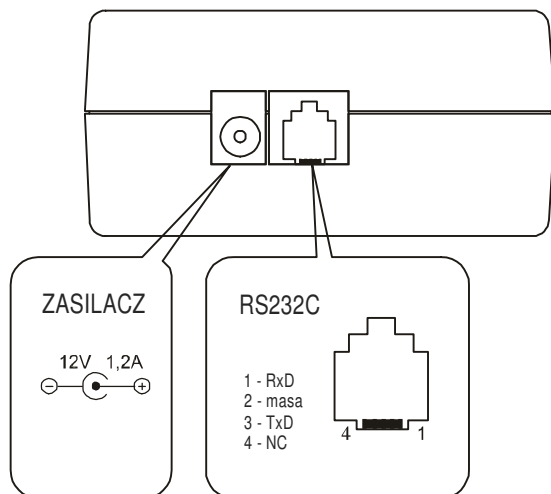

PL	EN
ZASILACZ	POWER SUPPLY UNIT
masa	earth

Description of the data transmission protocol when working with a computer (LonG):

The scales transmit the result as follows (8 bits, 1 stop, no parity, 4,800 bps):

Computer→Gauge: initiating signal S I CR LF (53 h 49 h 0Dh 0 Ah),


Gauge→Computer: gauge indication according to the following format (16 bytes).

Description of individual bytes:

byte	1	- “-“ or space
byte	2	- space
byte	3÷4	- digit or space
byte	5÷9	- digit, comma or space
byte	10	- digit
byte	11	- space
byte	12	- k, l, c, p or space
byte	13	- g, b, t, c or %
byte	14	- space
byte	15	- CR
byte	16	- LF

12. User's Menu

The User's Menu includes all functions and options necessary to operate the gauge or extend its functionalities.

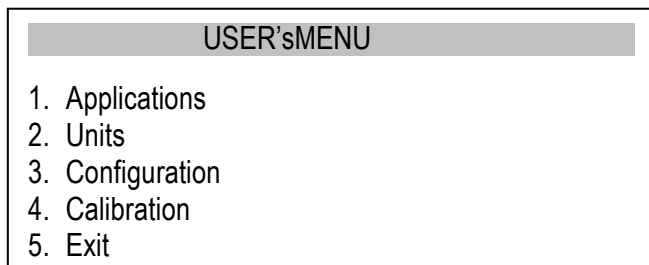

To use the options of the USER's MENU, use the MENU key. Move the cursor to the desired option and press ENTER.


The menu includes:

1. Applications – advanced measurement functions,
2. Units – select measurement units,
3. Configuration – set the gauge's mode of operation,
4. Calibration – adjust the measurement accuracy using an external standard of mass.
5. Exit.

13. Applications

This selection includes the following functions to effectively assist you with the measurement:

- memory operations and data analysis,
- comparison with two threshold values (MIN / MAX).

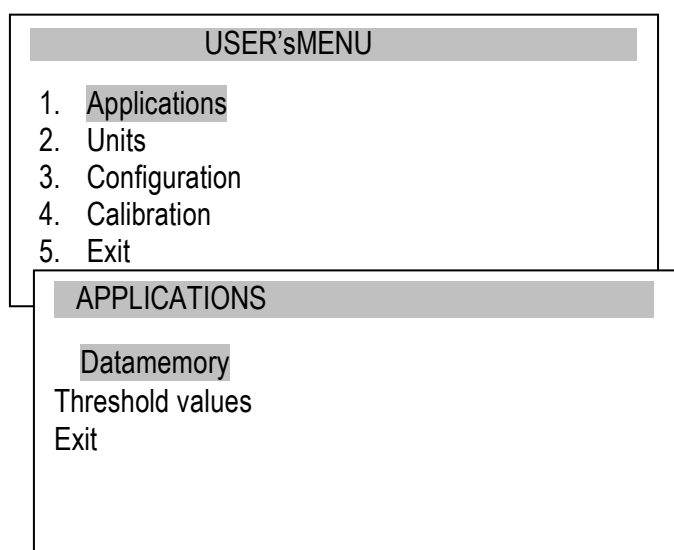

Move the cursor to Applications and press ENTER.

Move the cursor to the desired application and press ENTER.

13.1 Data memory

The Data memory application allows for the following:

- presentation of the collected measurements, saving, reading, erasing memory (Statistics),
- selecting the mode for collecting data,
- exit.

USER'sMENU

1. Applications
2. Units
3. Configuration
4. Calibration
5. Exit

APPLICATIONS

Datamemory

Threshold values

Exit

APPLICATIONS

1. Statistics
2. Mode <MANUAL> <AUTO>
3. Number of samples 100
4. Sampling time 0.1 sec
5. Exit

←

→

ENTER

Move the cursor to Applications and press ENTER.

Move the cursor to Data memory and press ENTER.

Setting the mode for collecting data:

- MANUAL – each time after MEM is pressed,
- AUTO – automatically at specified intervals.

APPLICATIONS

1. Statistics
2. Mode <MANUAL> <AUTO>
3. Number of samples 100
4. Sampling time 0.1 sec
5. Exit

After selecting AUTO, enter the number of samples (max 100) and sampling time (0.1÷99.9 s.).

APPLICATIONS

1. Statistics
2. Mode AUTO
3. Number of samples 100
4. Sampling time 0.1 sec
5. Exit

To start the collection of measurements, exit the menu and press MEM several times or press MEM for automatic save. When in the automatic save mode, press and hold MEM to go to the data save menu.

↑

↓

ENTER

Presentation of collected measurements (Statistics)

The Statistics option allows for the following forms of presentation of the collected data:

- <PRINT> – transmission to a printer,
- <HISTOGRAM> – bar graph,
- <GRAPH> – graph with a time axis.

USER'sMENU

1. Applications
2. Units
3. Configuration
4. Calibration
5. Exit

APPLICATIONS

Datamemory

Threshold values

Exit

DATAMEMORY

Statistics

Mode AUTO
 Number of samples 100
 4. Sampling time 0.1 sec
 6. Exit

Statistics

Quantity	100
Sum	990 g
Average	9 g
MAX	12 g
MIN	8 g

<PRINT><HISTOGRAM><GRAPH><SAVE><READ>
<RESET><DELETE><EXIT>

HISTOGRAM

←
→
ENTER

Move the cursor to Applications and press ENTER.

Move the cursor to Data memory and press ENTER.

Move the cursor to Statistics and press ENTER.

Select one of the options from the lower menu bar:

- PRINT – transmission to a printer,
- HISTOGRAM – bar graph,
- GRAPH – graph with a time axis.
- ...
- RESET – erases the entire memory,
- DELETE – deletes a selected memory file.

Indicators L... =... provide the size of the bar indicated by the ↑ arrow.

To move the arrow (scroll the graph), use the ← and → keys.

Save, read, erase memory (Statistics)

The Statistics option allows for the following:

- < SAVE > – saves the data currently presented,
- < READ > – reads a file from the memory,
- < RESET > – erases the data currently presented,
- < DELETE > – deletes a selected data file.

USER'sMENU

1. Applications
2. Units
3. Configuration
4. Calibration
5. Exit

APPLICATIONS

Datamemory

Threshold values

Exit

DATAMEMORY

1. Statistics
2. Mode <AUTO>
3. Number of samples 100
4. Sampling time 0.1 sec
5. Exit

Statistics

Quantity	100	
Sum	990 g	
Average	9 g	
MAX	12 g	
MIN	8 g	

<PRINT> ... <SAVE><READ> <RESET><EXIT>

SAVE DATA

< FILE01 >

< FILE02 >

...

< FILE08 >

↑
↓
ENTER

SAVEDATA

2009-12-17 10:00

< FILE02 >

...

< FILE08 >

↑
↓
ENTER

Move the cursor to Applications and press ENTER.

Move the cursor to Data memory and press ENTER.

Move the cursor to Statistics and press ENTER.

The following options (lower bar) will appear:

- ...
- SAVE – saves the measurements currently presented,
- READ – reads a measurement file,
- RESET – erases the memory,
- EXIT – exits the option.

Select the SAVE option.

Select a file (FILE) to be saved.

The default file name includes date and time. Confirm the default file name or enter another name using the →, ←, ↑ and ↓ keys.

13.2 Comparison with threshold values MIN / OK / MAX

This selection includes the following functions to effectively assist you with the measurement:

- memory operations and data analysis,
- comparison with two threshold values (MIN / MAX).

USER'sMENU

1. Applications
2. Units
3. Configuration
4. Calibration
5. Exit

APPLICATIONS

Data memory

Thresholdvalues

Exit

THRESHOLDVALUES

1. Status	<ON>	<OFF>
2. MIN		1.000kg
3. MAX		2.000kg
4. Buzzer		MODE1
5. Exit		

← → ENTER

Move the cursor to Applications and press ENTER.

Move the cursor to Threshold values and press ENTER.

Activate the comparison by setting Status to ON:

- enter the MIN value – lower threshold,
- enter the MAX value – upper threshold.

Select the option for sound signalling (Buzzer):

- MODE1 – short signal upon exceeding MIN, long signal upon exceeding MAX,
- MODE2 – interrupted signal below MIN, above MAX – continuous signal, for OK – no signal.

CONTINUOUS MEASUREMENT

OK

0.00N

- +

Exit the menu, start the measurement and observe the MIN, OK and MAX indicators on the gauge's display.

14. Units

The following units are available to the user:

- kilogram (kg)
- gram (g)
- Pound: 1 lb = 453.592374 g
- ounce: 1 oz = 28.349523 g
- Newton: 1 N = 0.10197 kg

To change the units, press the UNIT/CLEAR or MENU key several times.

USER'sMENU

1. Applications

2. **Units**

3. Configuration

4. Calibration

5. Exit

UNITS

Kilogram

[kg]

Gram

[g]

Pound

[lb]

Ounce

[oz]

Newton

[N]

Exit

ENTER

Press the MENU key, move the cursor to Units and press ENTER.

Move the cursor to the desired unit and press ENTER.

15. Configuration

This selection includes all options for setting the gauge's modes of operation.

USER'sMENU

1. Applications
2. Units
3. Configuration
4. Calibration
5. Exit

CONFIGURATION

1. Speedofmeasurement
2. Auto-reset
3. Print settings
4. RS-232C settings
5. LCD settings
6. Language
7. Date and time
8. Auto-OFF
9. Battery
10. Default settings
11. Exit

Move the cursor to Configuration and press ENTER.

Move the cursor to the desired option and press ENTER.

15.1 Speed of measurement

To obtain clear measurement results, it is recommended to adjust the speed of measurement to the dynamic properties of the measured object.

USER'sMENU

1. Applications
2. Units
3. Configuration
4. Calibration
5. Exit

CONFIGURATION

1. Speedofmeasurement
2. Auto-reset
3. Print settings
4. RS-232C settings
5. LCD settings

SPEEDOFMEASUREMENT

SLOW

FAST

Exit

ENTER

Press ENTER to select one of the options:

- SLOW – slow measurement,
- FAST – fast measurement.

15.2 Auto-reset

When activated, this option automatically maintains zero indications on the gauge, if the gauge's sensor is not affected by any external force or if the zero indication was produced by pressing the →T(0)← key. The range of values (calculated in the gauge's reading graduation near zero) subject to the reset must be entered under the Range option (3 digits).

USER'sMENU

1. Applications
2. Units
3. **Configuration**
4. Calibration
5. Exit

CONFIGURATION

1. Speed of measurement
2. **Auto-reset**
3. Print settings
4. RS-232C settings
5. LCD settings

AUTO-RESET

1. Status	<OFF>
2. Range	0 0 2 d
3. Exit	

↑

↓

ENTER

AUTO-RESET

1. Status	<ON> <OFF>
2. Range	2 d
3. Exit	

←

→

ENTER


Use the navigation keys and ENTER to select Status and one of the following options:

- ON – auto-reset ON,
- OFF – auto-reset OFF.

Next, select Range and use ↑, ↓, →, ← and ENTER to enter the auto-reset range (in reading graduation).

15.3 Print settings

According to the requirements of GLP procedures, it is possible use an external printer to produce print-outs from the gauge including text information.

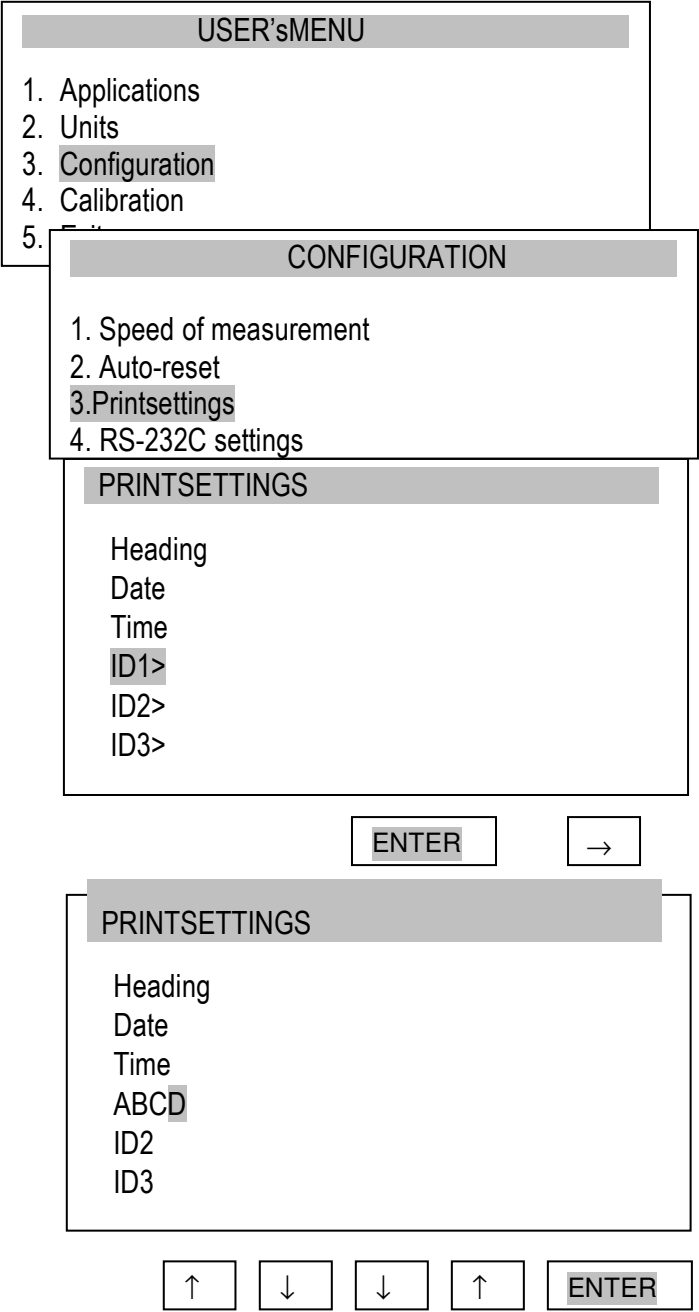

Use the navigation keys and ENTER to select Print settings and the suitable print components.

ID1, ID2, ID3 – text strings (up to 20 characters) forming the lines of the print-out, entered using the gauge's navigation keys.

To enter the characters, select ID using ENTER and press →. The characters are entered using the navigation keys ↑ and ↓. To move the cursor to the consecutive positions, use ← and →. To confirm the entered string, press ENTER. To delete a character, enter space.

15.4 Setting parameters for the RS-232C serial connector

The parameters of the serial connector must be suitable for the device receiving the signal.

USER'sMENU

1. Applications
2. Units
3. **Configuration**
4. Calibration

CONFIGURATION

1. Speed of measurement
2. Auto-reset
3. Print settings
4. **RS-232Csettings**
5. LCD settings

RS-232C

1. Baudrate	4800
2. Bits	8-bit
3. Parity	none
4. Sending	NORMAL
5. Exit	

↑
↓
ENTER

RS-232C

1. Baudrate	4800
2. Bits	8-bit
3. Parity	none
4. Sending	<NORMAL><NO STB><AUTOSTB> <CONTIN.>
5. Exit	

←
→
ENTER

Parameters to be set:

- Baudrate – transmission and receiving rate (4,800 ÷ 115,200 bps),
- Bits – number of bits which constitute a character (7 or 8 bits),
- Parity – control of parity (no control, even – confirmation of parity, or odd – confirmation of odd parity),
- Sending – transmission method during measurement:
 - NOCAL – after using the PRINT key, with stable result,
 - NOSTB – after using the PRINT key, irrespectively of the result stability,
 - AUTOSTB – automatically after the result has stabilised,
 - CONTIN. – continuous transmission, approx. every 0.1 s.

15.5 LCD settings

This option adjusts the gauge's display to external lighting conditions.

USER'sMENU

1. Applications
2. Units
3. **Configuration**
4. Calibration
2. Exit

CONFIGURATION

1. Speed of measurement
2. Auto-reset
3. Print settings
4. RS-232C settings
5. **LCDsettings**

SETTINGS

1. Contrast	<=====>
2. Illumination	<ON>
3. Direction	
4. LCD time	OFF
5. Exit	

↑
↓
ENTER

SETTINGS

1. Contrast	<=====>
2. Illumination	<ON><OFF><ECO><BAT>
3. Direction	
4. LCD time	OFF
5. Exit	

←
→
ENTER

SETTINGS

1. Contrast	<=====>
2. Illumination	<ECO>
3. Direction	<AUTO><UP><DOMN>
4. LCD time	OFF
5. Exit	

←
→
ENTER

Use the navigation keys and ENTER to select LCD settings. Next, use →, ← and ENTER to set the contrast at which the display is best legible.

When setting Illumination, select one of the following options:

- OFF – illumination OFF,
- ON – illumination continuously ON,
- ECO – to illuminate, use the BACKLIGHT key,
- BAT – illumination is turned off after 30 seconds to save the batteries.

The DIRECTION option is used for selecting the display's direction:

- AUTO – automatic rotation of the displayed image,
- UP – standard direction,
- DOMN – inverted image.

The LCD TIME option displays the date and time during measurement in the display's upper bar.

15.6 Selecting the menu language

Three menu languages are available:

<PL> – Polish,

<ENG> – English,

<DE> – German.

USER'sMENU

1. Applications
2. Units
3. Configuration
4. Calibration
5. Exit

CONFIGURATION

...

4. RS-232C settings
5. LCD settings
6. Language
7. Date and time
8. Auto-OFF

LANGUAGE

1. Language
2. Exit

<PL><ENG><DE>

← → ENTER

Use the navigation keys and ENTER to select Language. To select one of the available menu languages, use the →, ← keys and ENTER.

To enter a new code (NEW), select the PIN option. When entering a new code, type in the same number twice (message: REP.).

15.7 Setting date and time

This option is used for entering the current date and time. Access to this setting is secured by the PIN code.

The image shows a three-level menu system. The top level is 'USER'sMENU' with options 1. Applications, 2. Units, 3. Configuration (highlighted), 4. Calibration, and 5. Exit. The middle level is 'CONFIGURATION' with options 3. Print settings, 4. RS-232C settings, 5. LCD settings, 6. Language, 7. Dateandtime (highlighted), and 8. Auto-OFF. The bottom level is 'DATE AND TIME' with options 1. Time (highlighted), 2. Date, 3. PIN (with a cursor over the digit '0'), 4. Format (<EU><USA>), and 5. Exit. Below the menu boxes are three buttons: an up arrow, a down arrow, and an 'ENTER' button.

USER'sMENU	
1. Applications	
2. Units	
3. Configuration	
4. Calibration	
5. Exit	

CONFIGURATION	
3. Print settings	
4. RS-232C settings	
5. LCD settings	
6. Language	
7. Dateandtime	
8. Auto-OFF	

DATE AND TIME	
1. Time	hh:mm:ss
2. Date	yyyy-mm-dd
3. PIN	0
4. Format	<EU><USA>
5. Exit	

↑ ↓ ENTER


Use the navigation keys and ENTER to select Date and time. If a PIN has already been entered (other than 0), after selecting Time or Date, the cursor will move to the PIN option, where a correct 4-digit PIN has to be entered. To enter the correct digits, use the ↑, ↓, →, ← keys and ENTER.

To enter a new code (NEW), select the PIN option. When entering a new code, type in the same number twice (message: REP.).

The FORMAT option allows for the selection of the date format on print-outs.

15.8 Turning the sound ON/OFF when using the keypad (buzzer)

This options turns ON or OFF the sound signalling that a key on the keypad has been pressed. When the sound is turned on, the user usually does not apply excessive force when pushing the keys.

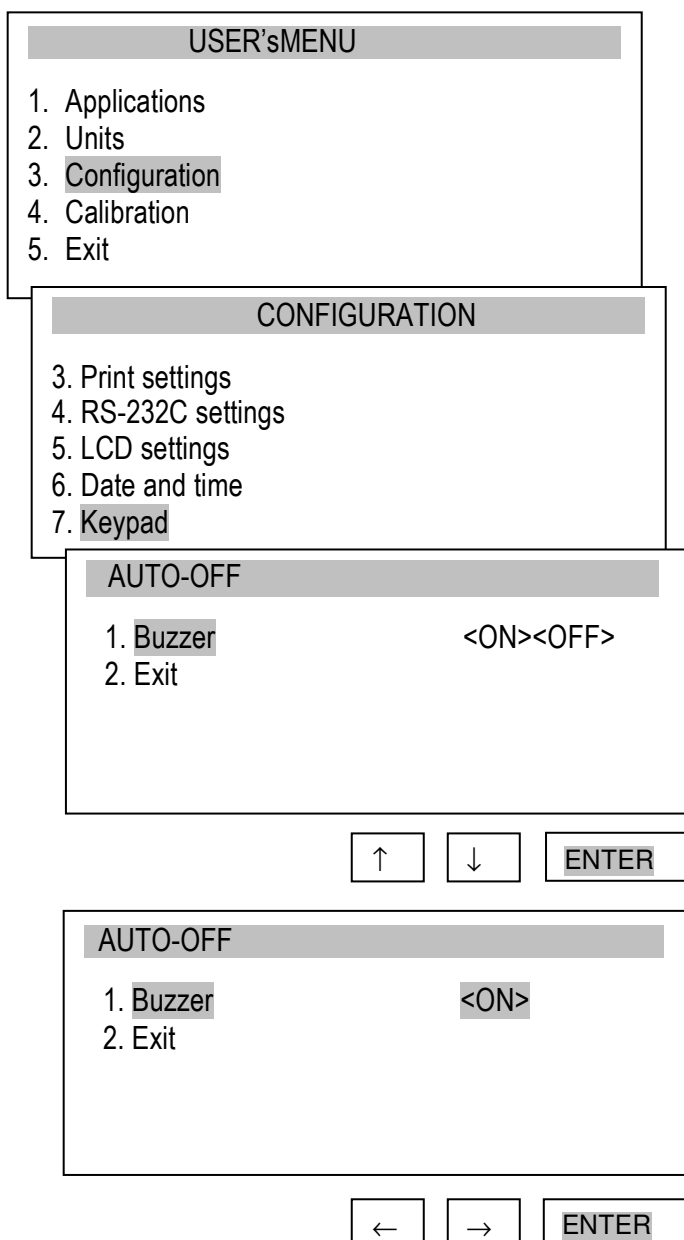

Use the navigation keys and ENTER to select Keypad and Buzzer, and one of the following options:

- ON – sound ON,
- OFF – sound OFF.

15.9 Automatic power OFF (Auto-OFF)

This option allows for an automatic cut-off of the gauge's power supply to save the battery's energy.

USER'sMENU

1. Applications
2. Units
3. Configuration
4. Calibration
5. Exit

CONFIGURATION

3. Print settings
4. RS-232C settings
5. LCD settings
6. Date and time
7. Auto-OFF

AUTO-OFF

1. Status OFF
2. Exit

↑

↓

ENTER

AUTO-OFF

1. Status: <OFF> <BAT> <ON>
2. Exit

←

→


ENTER

Use the navigation keys and ENTER to select Auto-OFF and Status, and one of the following options:

- ON – the power is turned off after 5 minutes, the indications remain unchanged,
- BAT – the power is turned off when the battery is low,
- OFF – the power is not turned off.

15.10 Monitoring the batteries' charge level (Battery)

This option is used for reading the charge level of the batteries and allows for the charging to be turned off to protect ordinary batteries, if such batteries are used instead of rechargeable batteries.

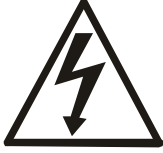

Charging ordinary batteries used instead of rechargeable batteries may lead to major damage to the gauge.

USER'sMENU

1. Applications
2. Units
3. Configuration
4. Calibration
5. Exit

CONFIGURATION

5. LCD settings
6. Language
7. Date and time
8. Auto-OFF
9. Battery

BATTERY

1.Charging	OFF
2. Charge level	80%
3. Exit	

↑

↓

ENTER

Use the navigation keys and ENTER to select Battery and Charging, and one of the following options:

- ON – charging ON,
- OFF – charging OFF.

BATTERY

1.Charging	<OFF> <ON>	
2. Charge level	80%	
3. Exit		

←

→

ENTER

15.11 Reset settings

This option restores factory settings (default settings) for all options.

USER'sMENU

- 3. Applications
- 4. Units
- 5. Configuration
- 6. Calibration
- 7. Exit

CONFIGURATION

- 7. Date and time
- 8. Auto-OFF
- 9. Battery
- 10. Resetsettings

RESET SETTINGS

Restore default settings?

NO
YES

 
↑ ↓ ENTER

Use the navigation keys and ENTER to select Reset settings and the option YES.

As a result of restoring factory settings, the gauge will reset and start continuous measurement.

16. Calibration

To calibrate the gauge, select the method of applying load. For this purpose, use a stand or suspend a standard of mass on the gauge.



Reset the gauge without load using the $\rightarrow T(0) \leftarrow$ key.

USER's MENU	
6.	Applications
7.	Units
8.	Configuration
9.	Calibration
10.	Exit

ENTER to select Calibration and Load.


CALIBRATION	
1.	Calibration
2.	Load <5kg> <20kg> <10kg> <...>
3.	$g = 9.81416 \text{ m/s}^2$
4.	Geographical location
5.	Exit

Select the load depending on the standard of mass. The <...> option

to correctly convert mass (kg) into force (N).


If the exact “g” value is not known, enter the parameters of the geographical location (latitude and above mean sea level). The “g” value will be calculated automatically.

 Apply the standard of mass to the gauge.



CALIBRATION	
1.	Calibration
2.	Load 5kg
3.	$g = 9.81416 \text{ m/s}^2$
4.	Geographical location
5.	Exit

 Use the navigation keys and ENTER to select Calibration and wait until the calibration process is completed.



17. Maintenance, troubleshooting and repairing minor types of damage

1. Keep the gauge clean.
2. When using the force gauge, make sure that no contamination gets between the gauge plunger and the enclosure. Upon identifying any contamination, remove it using a tool which does not conduct electricity.
3. Unauthorised persons may not perform any repairs.
4. Have the gauge repaired by your local servicing facility. A list of servicing facilities is enclosed in the warranty.

Messages and faults:

Message/fault	Cause	Recommendation
The message RESETTING is displayed for an extended period of time.	Resetting process disturbed	Keep the gauge in motionless position and press →T(0)←
Message: AD range exceeded (+/-)	Resetting process disturbed	Put the gauge in horizontal position and turn it off and on using the ON/OFF key.
The values indicated by the gauge diverge significantly from correct values	Gauge out of adjustment	Contact a servicing facility to calibrate the gauge
Units displayed are different from the selected units	UNIT/CLEAR key pressed by accident	Press the UNIT/CLEAR key several times to display the correct units

Notes

